

# PART NO. 330252BSE

LI2YCH-TP/TT Signal Control Cable, 2 x 2 x 0.22 mm²

## Detailed Specifications & Technical Data

### CROSS SECTION



1 Conductor
2 Insulation
3 Stranding
4 Wrapping
5 Screen
6 Outer Jacket

### CABLE CONSTRUCTION

| | |
|---|---|
| Conductor | : Stranded electrolytic copper conductor (Class 5) (IEC 60228, EN 60228, DIN VDE 0295) |
| Insulation | : Solid polyethylene (EN 50290-2-23, BS 6234 Type 03 – ASTM D 1248) (DIN 47100) |
| Stranding | : Insulations are stranded into pairs or triads and all pairs or triads are stranded together. |
| Wrapping | : Polyester tape |
| Screen | : Tinned copper braiding |
| Outer Jacket | : UV resistant halogen-free outer jacket. RAL 7035 (Grey) |

### TECHNICAL DATA

| | |
|---|---|
| Cross Section | : 0.22 mm² |
| Conductor Resistance (20 °C) Ω/km | : 85.0 |
| Insulation Resistance (20 °C) MΩ/km | : 5000 |
| Mutual Capacitance nF/km | : 110 |
| Operating Voltage V DC | : 250 |
| Test Voltage (@ 1 minute) V DC | : 1200 |

### STANDARDS

| | |
|---|---|
| Smoke Density Test | : IEC 61034-2, VDE 0482-1034-2, BS EN 61034-2 |
| Corrosive Gas Test | : IEC 60754-2, VDE 0482-267-2-3, BS EN 50267-2-3 |
| Halogen-free Test | : IEC 60754-1, VDE 0482-267-2-1, BS EN 50267-2-1 |
| Flame Propagation Test | : IEC 60332-3-24, VDE 0482-332-3-24, EN 60332-2-24 |
| Flame Retardancy Test | : IEC 60332-1-2, VDE 0482-332-1-2, BS EN 60332-1-2 |

### MECHANICAL CHARACTERISTICS

| | |
|---|---|
| Bending Radius | : 7.5xD mm |
| Temperature Range Operating | : -30°C ~ +70°C |

### CABLE TYPE DATA

| CAMCOM Part No. | Conductor Count | Pair Count | Conductor Cross-section (mm²) | Approx. Cable Diameter (mm) | Copper Weight (kg/km) | Approx. Weight (kg/km) | Packing Lengths (m) |
|---|---|---|---|---|---|---|---|
| 330252BSE | – | 2 | 0.22 | 4.9 | 15.1 | 31 | 100/500/1000 |

### PRODUCT VIEW

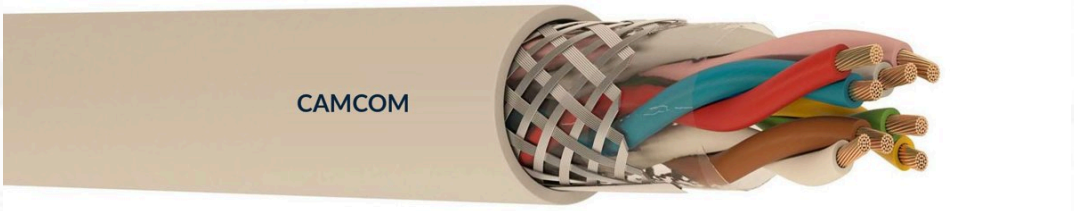


**Camcom** is proud to be certified by

Frame Offices - HQ, Alexanderveld 5-9,
2585 DB, Den Haag, Netherlands
+31708910864
sales@camcom.co.nl

Designed in Netherlands & Produced Globally.

Prepared By : Steve Smith

Disclamer :- Datasheet is subject to modification without prior notication

© Technovation Alliance Enterprise B.V.